
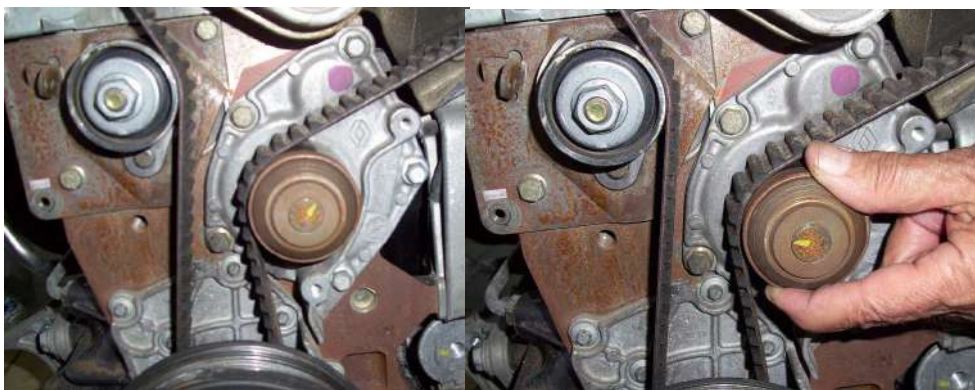


Technical Information Sheet

R219 / R229 water pumps

Adjusting timing belt tension

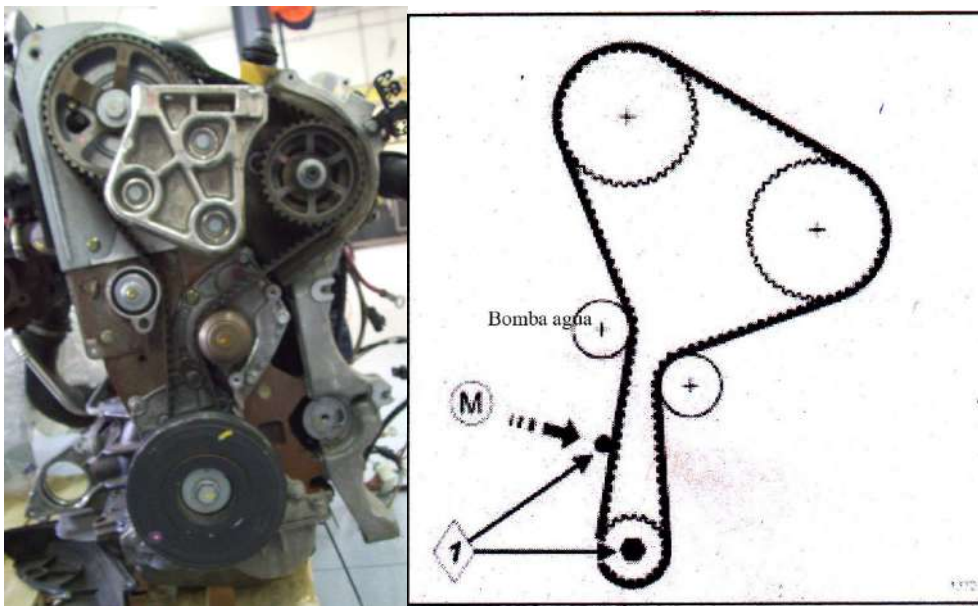

After tensioning the timing belt, the water pump pulley should be able to be turned easily by hand.



Bomba de Agua
Water Pump

According to the official Renault timing belt tensioning document:

For F9Q 200, 204, 650, 670, 718, 750, 751, 752, 754, 760, 762, 772, 774, 820 engines, the timing belt must be adjusted at the point marked on the diagram with the letter M with an electronic device at a value of 90 +/- 3 hz. (Vibration parameter frequency).

For F9Q 260, 262, 264, 660, 664, 674, 757, 758, 759, 794, 800, 803, 804, 808, 812, 814 engines, the timing belt must be adjusted at the point marked on the diagram, with the letter M with an electronic device at a value of 78 +/- 3 hz. (Vibration parameter frequency).